

# Elcometer 510

Automatic Adhesion Gauge

## Adhesion - Pull-Off

# elcometer

## **Elcometer 510**

STANDARDS: ASTM C1583, ASTM D4541, ASTM D7234-12, AS/NZS 1580.408.5, BS 1881-207, DIN 1048-2, EN 1015-12, EN 12636, EN 13144, EN 1542, EN 24624, ISO 16276-1, ISO 4624, JIS K 5600 5-7, NF T30-606, NF T30-062

## Automatic Pull-Off Adhesion Gauge

The Elcometer 510 Automatic Pull-Off Adhesion Gauge accurately measures the strength of the bond between the coating and the substrate.

Hand-held, waterproof rugged design equivalent to IP64 Automatic hydraulic pump ensures smooth and continuous AND DEPARTMENT pressure application for consistent. repeatable results Fully adjustable pull rates 0.1-1.4MPa/s (15-203psi) to meet National and International Standards User definable measurement range with an accuracy of ±1% of full scale: 10mm dolly: 100MPa / 14400psi 14.2mm dolly: 50MPa / 7200psi 20mm dolly: 25MPa / 3600psi 50mm dolly: 4MPa / 580psi 10, 14.2, 20 and 50mm diameter dolly options The survey of the second User definable limits with unique pressure hold and release function Suitable for use in Cloud Computing Store up to 60,000 readings with Intuitive & easy to individual pull graphs in up to 2,500 use menu structure in alpha numerical batches, complete 'EAR multiple languages with attribute failure information WARRANT Made for compatible with 😢 Bluetooth® <sup>¶</sup> ™Android □ iPod □ iPhone □ iPad ElcoMaster. Elcometer 510 Model T: Made for iPhone 6 Plus, iPhone 6, iPhone 5s, iPhone 5c, iPhone 5, iPhone 4s, iPhone 4, iPad Air 2, iPad mini 3, iPad Air, iPad mini 2, iPad (3rd and 4th generation), iPad mini,

Elcometer 510 Model 1: Made for iPhone 6 Plus, iPhone 6, iPhone 5s, iPhone 5s, iPhone 5, iPhone 4s, iPhone 4, iPad Air 2, iPad mini 3, iPad Air, iPad mini 2, iPad (3rd and 4th generation), iPad mini, iPad 2, and iPod touch (4th and 5th generation). "Made for iPod," "Made for iPhone," and "Made for iPad" mean that an electronic accessory has been designed to connect specifically to iPod touch, iPhone, or iPad, respectively, and has been certified by the developer to meet Apple performance standards. Apple is not responsible for the operation of this device or its compliance with safety and regulatory standards. Please note that the use of this accessory with iPod touch, iPhone, or iPad may affect wireless performance.

### Automatic Pull-Off Adhesion Gauge

### **Elcometer 510**

## Powerful

- Suitable for use on metal, wood, concrete and other substrates
- Smooth load application up to 100MPa (14400 psi)
- USB and Bluetooth<sup>®</sup> data output to iOS<sup>†</sup> or Android<sup>™</sup> devices
- Stores up to 60,000 readings in 2,500 batches

## Durable

- · Sealed, heavy duty and impact resistant
- Dust and waterproof equivalent to IP64
- Suitable for use in harsh environments

## Efficient

- Ideal for laboratory and field use
- 10, 14.2, 20 and 50mm (0.39, 0.56, 0.76 & 1.96") diameter reusable dollies
- Compatible with ElcoMaster<sup>®</sup> and ElcoMaster<sup>®</sup> Mobile App
- · Measures on small, curved and flat surfaces

## Accurate

- Measurement range up to 100MPa (14400 psi) with an accuracy of ±1% of full scale
- Can be used in accordance with National & International Standards



\* Elcometer 510 gauges are supplied with a one year warranty against manufacturing defects. The warranty can be extended to two years via www.elcometer.com

<sup>+</sup> Compatible with iPod, iPhone and iPad.

## Elcometer 510

## Automatic Pull-Off Adhesion Gauge

## Key Features Explained



Automatic adhesion tester with selectable pull rates for 10, 14.2, 20 & 50mm diameter dollies.



View trend graphs or live statistics alongside the reading value.



Individual user definable pull rate graphs can be saved with each reading.



Stores individual readings and pull rate graphs in up to 2,500 alpha numeric batches, together with date, time and attribute information.



Either pull to maximum or pull to preset limit. Unique time hold feature allows users to set a delay before pressure returns to zero.



Save cohesive and adhesive failure attributes alongside your adhesion pull data in accordance with National and International Standards.



### Testing coatings on low bond strength substrates

When testing coatings on low bond strength substrates such as concrete, wood or other fibrous materials, a larger surface area of dolly (50mm) is required to provide accurate, repeatable and reproducible results.

The Elcometer 510 is available as a Concrete Adhesion Tester Kit, or 50mm accessory items (skirt, dolly, cutter) can be added to existing Elcometer 510 adhesion kits.

### Automatic Pull-Off Adhesion Gauge

### **Elcometer 510**



Powered by either standard rechargeable batteries or AC mains\*. Each battery charge performs up to 200 pulls. Battery recharge time <300 minutes.



Transfer data to your PC via USB or Bluetooth<sup>®</sup> for further analysis with ElcoMaster<sup>®</sup> software or view live pull rate graphs in ElcoMaster<sup>®</sup> during the test.



Using wireless Bluetooth<sup>®</sup> communication link the gauge to an Android<sup>™</sup> or iPhone<sup>‡</sup> mobile device. Live GPS coordinates from your mobile device can be added to reports and emailed instantly.



A range of interchangeable thin & standard substrate skirt adaptors allow each gauge to be used with 10, 14.2, 20 or 50mm diameter reusable dollies, ideal for testing coatings on thin, thick, flat or convex substrates.



The optional magnetic anchor clamp ensures the actuator doesn't fall during tests on vertical surfaces or testing at height.




Supplied in a robust plastic carry case for easy transportation to and around the job site.



### Adhesion Verification Unit for Verification in the Field

The Elcometer 510 gauge's inbuilt Adhesion Verification feature allows users to connect the gauge to the Elcometer AVU to verify gauge accuracy in the field.

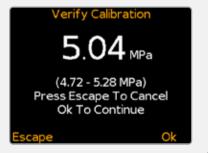

\* Model T only.

+ iPod, iPhone and iPad compatible.

## Elcometer 510


## Automatic Pull-Off Adhesion Gauge


### Assessing The Results - Failure Attributes

Many National and International Standards, including ISO 4624 & ASTM D4541, require the user to record not only the pull-off force but also the nature of the failure. This is done by examining the bottom of the dolly and assessing the failure. In 'Advanced' mode on the Elcometer 510 it is possible to select the 'Attributes' feature (Menu/Setup/ Gauge Mode/Advanced) allowing the nature of the fracture to be recorded against each reading and stored within the batch.

### **Examining The Dolly**

- a) Cohesive Failure: The coating fails within the body of a coating layer leaving the same coating on the surface and on the dolly face.
- b) Adhesive Failure: Failure occurs at the interface between layers (intercoat) where one pulls away from the other. The "coating" on the dolly face will not be the same as that on the test area.
- c) Glue Failure: When no coating is present on the dolly it must be recorded as a failure of the glue. This may be due to incorrect or insufficient mixing of the component parts of the adhesive, incompatibility between the adhesive/coating/dolly/test surface.

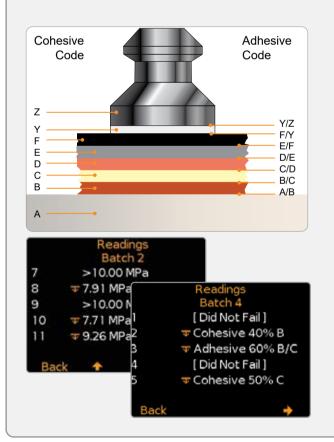

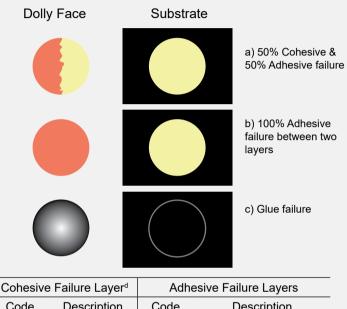

Concorver andre Edyer		Adhesive Fallare Eagers		
Code	Description	Code Description		
A	Substrate	A/B Substrate & Layer		
В	Layer 1	B/C	Layer 1 & Layer 2	
С	Layer 2	C/D	Layer 2 & Layer 3	
D	Layer 3	D/E	Layer 3 & Layer 4	
E	Layer 4	E/F	Layer 4 & Layer 5	
F	Layer 5	F/Y	Layer 5 & Glue	
Y	Glue	Y/Z	Glue & Dolly	

The data is saved in the batch and can be viewed at any time displayed as

##.## MPa <sup>®</sup>	<b>N% A M% A/B</b> , where;
##.## MPa <sup>e</sup>	<ul> <li>Pull Force in MPa or other measurement units (psi, Newtons or Nmm<sup>-2</sup>)</li> </ul>
N% A M% A/B	<ul> <li>Cohesive failure percentage<sup>f</sup></li> <li>Cohesive failure layer</li> <li>Adhesion failure percentage<sup>f</sup></li> <li>Intercoat adhesive failure layers</li> </ul>

<sup>d</sup> The number of layers can be user defined for each batch via Batch/New Batch/Number of Layers. This will affect the number of layers available for selection during attribute recording. The maximum number of layers available is five, excluding the substrate and glue.

<sup>e</sup> Or equivalent units. <sup>f</sup> To the nearest 10%, in line with International Standards.

## Automatic Pull-Off Adhesion Gauge

## Elcometer 510

Create instant reports with ElcoMaster®

What you do with the collected data is just as important as taking the readings themselves.

ElcoMaster<sup>®</sup> is a fast, easy to use software solution for all your data management and quality assurance needs, preparing professional inspection reports at the click of a button.

Whether you are out in the field or on the factory floor, using the ElcoMaster<sup>®</sup> Mobile App users can;


- Store live readings directly on to a mobile device and save them into batches.
- View the pull rate graph in real-time for the duration of the test.
- Add attribute data to each individual batch reading.
- Add photographs of the dolly and test surface to each individual batch reading at the click of a button.
- Plot individual readings on to a location map, photograph or diagram.
- Inspection data can be transferred from mobile to PC for further analysis and reporting.
- Generate instant .pdf<sup>1</sup> report for submission.

Combine different inspection parameters (such as dry film thickness, surface profile, salt contamination, climate or adhesion) together with images, notes and other project specific information into customised reports.

Data transferred from the gauge to ElcoMaster® includes;

- Adhesion Measurements
- Date & Time
- Cohesive/Adhesive Failure Attributes
- Dolly size
- Pull rate graph
- Pull to Limit/Max
- Limit values
- Limit Hold Time
- Cutting Device
- Number of Layers
- Skirt Type/Support Ring Dimensions
- Batch Information & Statistics
- Calibration Information
- Calibration Verification Date/Time



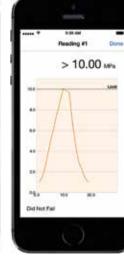



<sup>1</sup> Available on iOS devices only

## Elcometer 510

### Automatic Pull-Off Adhesion Gauge

Product Features	Standard	Optional
	Model S	Model T
Repeatable & reproducible measurements		
Easy to use menu structure; in multiple languages		
Tough, impact, waterproof & dust resistant; equivalent to IP64		
Bright LCD colour screen; with ambient light sensor		
Scratch & solvent resistant display; 2.4" (6cm) TFT		
Calibration certificate		
2 year gauge warranty⁺		
Automatic rotating display; 0°, 180°		
Data output via USB (Live readings - and batch)		
Data output via Bluetooth®		
PC command; start & stop gauge from a PC with live readings (USB only)		
Switchable Units (MPa, psi, N, Nmm <sup>-2</sup> )		
On-Screen Statistics ( $\eta$ , $\bar{x}$ , $\sigma$ , Hi, Lo, CV%, N>hi limit <sup>+</sup> )		
Pull Rate Indicator		
Trend Graph		
Pull Rate Graph (Load v Time)		
Interchangeable Dolly Selection; 10, 14.2, 20 & 50mm		
User Selectable Pull Rates; (Model S & Model T Standard Mode)           10mm:         1.00, 2.00, 3.00, 4.00, 5.00 MPa/s         125, 200, 400, 600, 725psi/s           14.2mm:         0.4, 0.7, 1.4, 2.0, 2.5 MPa/s         60, 100, 200, 300, 360psi/s           20mm:         0.2, 0.3, 0.7, 1.0, 1.2 MPa/s         30, 50, 100, 150, 180psi/s           50mm:         0.04, 0.08, 0.12, 0.16, 0.20 MPa/s         5, 8, 16, 24, 30psi/s	•	
Jser Selectable Pull Rates; (Model T Advanced Mode) 10mm: 0.40 - 5.60 MPa/s 58 - 812psi/s in 0.1MPa / 1psi steps 14.2mm: 0.20 - 2.80 MPa/s 29 - 403psi/s in 0.1MPa / 1psi steps 20mm: 0.10 - 1.40 MPa/s 15 - 203psi/s in 0.1MPa / 1psi steps 50mm: 0.02 - 0.22 MPa/s 2 - 32psi/s in 0.01MPa / 0.1psi steps		
Jser Selectable Limit & Limit Hold Time		
Gauge Memory; maximum number of readings	60	60,000*
Number of Batches (Alpha Numeric - Model T)	1	2,500
Attribute Modes to meet National & International Standards		
Display Modes		
Readings, Selected Stats & Run Chart (last 20 readings)		
Pull Rate Graphs		
Batch Review		
Power; Battery (B), AC Mains Power (M)	В	В, М
USB Cable & ElcoMaster <sup>®</sup> CD		
Power Cable with Multi International Plug Adaptor (UK, EU, US, AUS)		
Plastic Transit Case		
Date & Time		
In Field Adhesion Calibration Verification Mode	1 A A A A A A A A A A A A A A A A A A A	

\* The Elcometer 510 is extendable within 60 days from date of purchase, free of charge, to 2 years via www.elcometer.com

<sup>+</sup> Model T only.

\* When 'Rate Graph' is enabled, the number of readings which can be stored depends on the graph resolution selected

## Automatic Pull-Off Adhesion Gauge

### **Elcometer 510**

Part Number	Description			Certificate	
F510-20S	Elcometer 510 Model S Automatic Adhesion Gauge; 20mm Kit			•	
F510-20T	Elcometer 510 Model T Automatic Adhesion Gauge; 20mm Kit			•	
F510-50S	Elcometer 510 Model	•			
F510-50T	Elcometer 510 Model T Automatic Adhesion Gauge; 50mm Concrete Kit				
Pressure Accuracy	±1% of full scale		Pull Rate Accuracy	±(2.5% + 0.3 seconds)	
Pressure Resolution	0.01MPa (1 psi)		Pull Rate Resolution	0.01MPa/s (1psi/s)	
Dolly Diameter	10mm (0.39")	14.2mm (0.56")	20mm (0.76")	50mm (1.96")	
Operating Range	8 - 100 MPa (1200 - 14400 psi)	4 - 50 MPa (600 - 7200 psi)	2 - 25 MPa (300 - 3600 psi)	0.3 - 4 MPa (50 - 580 psi)	
Pull Rate Range	0.4 - 5.6MPa/s (58 - 812psi/s)	0.2 - 2.8MPa/s (29 - 403psi/s)	0.1 - 1.4MPa/s (15 - 203psi/s)	0.02 - 0.22MPa/s (2 - 32psi/s)	
Gauge Dimensions	260 x 100 x 66mm (6.	3 x 3.9 x 2.6")			
Actuator Height <sup>1</sup>	85mm (3.4")	85mm (3.4")	85mm (3.4")	110mm (4.3")	
Instrument Weight <sup>1</sup>	2.9kg (6.4lb)	2.9kg (6.4lb)	2.9kg (6.4lb) 2.9kg (6.4lb)		
Kit Weight	-	-	6.1kg (13.5lb)	7.3kg (16.1lb)	
Power Supply	8 x AA batteries (16 rechargeable batteries supplied complete with charger) or AC mains power (Model T only)				
Battery Life	~200 pulls per charge up to 25MPa (3600psi) at 1MPa/s (150psi/s), recharge time <5 hours				
Packing List: 20mm Kit	cutter handle, 20mm o pad, shoulder harness	lolly cutter, Araldite stand , carry case, 16 x AA MiN JK, EU, US, AUS) (Mode	ollies (x10), standard skirt fo dard two part epoxy adhesiv /IH rechargeable batteries & II T), ElcoMaster® CD & USB	e (2 x 15ml tubes), abrasiv charger (UK, EU, US, AUS)	
Packing List: 50mm Kit	cutter arbor, 50mm do pad, shoulder harness	olly cutter, Araldite stand , carry case, 16 x AA MiN JK, EU, US, AUS) (Mode	ollies (x6), standard skirt for ard two part epoxy adhesive /IH rechargeable batteries & II T), ElcoMaster® CD & USB	e (2 x 15ml tubes), abrasive charger (UK, EU, US, AUS)	
Accessories					

10mm (0.39")	T5100010AL-10 T5100010AL-100	T9991420S	-	-	-
14.2mm (0.56")	T9990014AL-10 T9990014AL-100	T9991420S	T9990014T	T9991420H	T9990014CT
20mm (0.76")	T9990020AL-10 T9990020AL-100	T9991420S	T9990020T	T9991420H	T9990020CT
50mm (1.96")	T9990050AL-4 -	T9990050S	-	T9990050H	T9990050CT
50mm (1.96") Stainless Steel	T9990050SS-4 -	T9990050S	-	T9990050H	T9990050CT
Part Number	Description				
T99923797	Magnetic Anchor Clamp - holds actuator securely during tests on vertical surfaces				
T99912906	Araldite Standard Two Part Epoxy Adhesive, 2 x 15ml Tubes				
T99923147	Dolly Cleaning Heating Tongs - EUR 220V / UK 240V				
T99923103	Dolly Cleaning Heating Tongs - US 110V				

• Calibration Certificate supplied as standard.

<sup>1</sup> Including Actuator with Standard Skirt fitted. <sup>†</sup> 50mm (2") dollies are supplied in packs of 4.

## Elcometer 510 Automatic Pull-Off Adhesion Gauge


### Pull-Off Adhesion Tests - Preventing Adhesive and Cohesive Failures

#### Preparing the surface and dolly

- 1. Select an appropriate test area which is flat and has sufficient area to attach the adhesion gauge.
- 2. Abrade the dolly and surface, clean both to remove any dust minimising the risk of an 'adhesive' failure.

#### Fixing the dolly

- 3. Mix the adhesive correctly and apply a uniform adhesive film over the entire dolly face.
- 4. Test Standards require that the dolly is pulled off perpendicularly to the test surface. The dolly must therefore be adhered on to a prepared flat test surface (see images below). Apply an even pressure to the dolly to ensure that the dolly face is parallel to the test surface.
- 5. Remove any excess adhesive from around the dolly and allow to fully cure. Tape maybe required when applying dollies to vertical surfaces during the cure process.
- 6. If required, once the dolly has fully cured, score the coating around the dolly using the dolly cutter provided.
- 7. Attach the gauge actuator to the dolly and begin test.

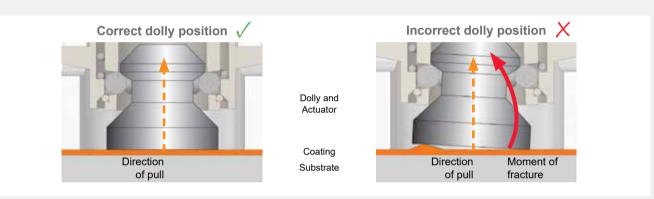


### Assessment of the Adhesion Test

For a valid pull test the coating must cover at least 50% of the area of the dolly face. If the glue fails and no coating is present on the dolly, or it covers less than 50% of the dolly face area, the pull-test is invalid and should be repeated.

When the coating has failed within the layer leaving the same coating on both the dolly and the test panel it is known as a *'cohesive failure'*.

'Adhesive failures' occur when either the coating has failed at the interface with another coating (leaving a coating on the dolly and another coating on the substrate), or when the coating has failed at the substrate (leaving the coating on the dolly and the substrate bare).

NOTE: If the glue fails at a value above the specification then it can be reported that the adhesion exceeded the specification for this individual test.

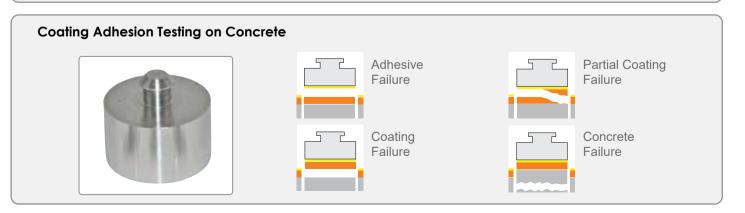

**Elcometer AVU** 

### Adhesion Verification Unit (AVU)

The Elcometer AVU has been designed to provide users with the means to confirm the accuracy of their pull-off adhesion gauge.

Due to its robust design the Elcometer AVU is suitable for use on site or in the laboratory and allows users to verify or self-certify their pull-off adhesion gauges.

A range of dolly adaptors are available for testing the Elcometer 106, Elcometer 506 and Elcometer 510 adhesion gauges. Adaptors are also available for testing other manufacturers' gauges.

Attach the appropriate dolly adaptor to the AVU, connect your adhesion gauge, apply load and compare the adhesion tester value to the reading on the AVU Display.

Features include:

- Max hold and live reading display
- MPa / psi switchable units
- Backlit display
- Automatic switch off

The Elcometer AVU is supplied with either a test certificate or full calibration certificate, suitable for self-certification.

Technical Specificat	ion	С	
Part Number	Description	Certificate	
T99923924	Elcometer AVU Adhesion Verification Unit	•	
T99923924C	Elcometer AVU Adhesion Verification Unit - Certified	0	
Range	0-30MPa (0-4000psi)		
Resolution	0.01MPa (1psi)		
Accuracy	±0.1MPa (±14.5psi)		
Battery Type	2 x AA batteries		
Gauge Dimensions	165 x 155 x 105mm (6.5 x 6.1 x 4.1")		
Gauge Weight	3kg (6.6lbs)		
Packing List	Elcometer AVU, Elcometer 506/510 20mm (0.76") dolly adaptor, test or calibrat (as appropriate), 2 x AA batteries, carry case and operating instructions	ion certificate	
Accessories			
T99923935	Elcometer 506 & 510 Dolly Adaptor; 20 & 14.2mm (0.76 & 0.56") Skirts		
T99923936	Elcometer 506 & 510 Dolly Adaptor; 50mm (2.0") Skirt		
T99923937	Elcometer 106 Dolly Adaptor; Scales 1 to 4		
T99923938	Elcometer 106 Dolly Adaptor; Scale 6		

T99923939AT-M & AT-A Adhesion Gauge Dolly AdaptorT99923986PAT Adhesion Gauge Dolly Adaptor

Test Certificate supplied as standard.

• Calibration Certificate supplied as standard.

#### ENGLAND

Elcometer Limited Manchester M43 6BU Tel: +44 (0)161 371 6000 Fax: +44 (0)161 371 6010 sales@elcometer.com www.elcometer.com

#### BELGIUM

Elcometer SA Tel: +32 (0)4 379 96 10 Fax: +32 (0)4 374 06 03 be\_info@elcometer.com www.elcometer.be

#### FRANCE

Elcometer Sarl Tel: +33 (0)2 38 86 33 44 Fax: +33 (0)2 38 91 37 66 fr\_info@elcometer.com www.elcometer.fr

#### GERMANY

Elcometer Instruments GmbH Tel: +49(0)7361 52806 0 Fax: +49(0)7361 52806 77 de\_info@elcometer.com www.elcometer.de

### THE NETHERLANDS

Elcometer B.V. Tel: +31 (0)30 259 1818 Fax: +31 (0)30 210 6666 nl\_info@elcometer.com www.elcometer.nl

#### JAPAN

Elcometer KK Tel: +81-(0)3-6869-0770 Fax: +81-(0)3-6433-1220 jp\_info@elcometer.com www.elcometer.jp

#### **REPUBLIC OF SINGAPORE**

Elcometer (Asia) Pte Ltd Tel: +65 6462 2822 Fax: +65 6462 2860 asia@elcometer.com www.elcometer.com.sg

### UNITED ARAB EMIRATES

EL Inspection & Blasting Equipment LLC Tel: +971 4 295 0191 Fax: +971 4 295 0192 uae\_sales@elcometer.com www.elcometer.ae

### USA

MICHIGAN Elcometer Inc Tel: +1 248 650 0500 Toll Free: 800 521 0635 Fax: +1 248 650 0501 inc@elcometer.com www.elcometer.com

### TEXAS

Elcometer of Houston Tel: +1 713 450 0631 Toll Free: 800 521 0635 Fax: +1 713 450 0632 inc@elcometer.com www.elcometer.com



#### elcometer.be • elcometer.fr • elcometer.de • elcometer.nl elcometer.jp • elcometer.ae • elcomet<u>er.com.sg</u>

Elcometer 510 Model T: Made for iPhone 6 Plus, iPhone 6, iPhone 5s, iPhone 5c, iPhone 5, iPhone 4s, iPhone 4, iPad Air 2, iPad Mini 3, iPad Air, iPad mini 2, iPad (3rd and 4th generation), iPad min, iPad 2, and iPod touch (4th and 5th generation). 'Made for iPhone," and 'Made for iPhone," and 'Made for iPhone, and 'Made for iPhone, or iPad, respectively, and has been certified by the developer to meet Apple performance standards. Apple is not responsible for the operation of this device or its compliance with safety and regulatory standards. Places note that the use of this accessory with iPod, iPhone, or iPad may affect wireless performance. iPad, iPhone, and iPod touch are trademarks of Apple Inc., registered in the U.S. and other countries. App Store is a trademark of Apple Inc., registered in the U.S. and other countries. Suitable for mobile devices running Android software version 2.1 and upwards. Elcometer and ElcoMaster<sup>®</sup> are registered trademarks of Elcometer Limited. All other trademarks deviced.

© Elcometer Limited, 2016. All rights reserved. No part of this document may be reproduced, transmitted, stored (in a retrieval system or otherwise), or translated into any language, in any form, or by any means, without the prior written permission of Elcometer Limited.

Due to our policy of continuous improvement, Elcometer Limited reserves the right to change specifications without notice. All gauges come with a 1 year warranty as standard, the Elcometer 510 is extendable within 60 days from date of purchase, free of charge, to 2 years via www.elcometer.com